

Carbon ZEBRA Connector

ZEBRA is registered Trademarks of FUJIPOLY in USA, Canada, UK, Hong Kong, Thailand and Shingapore.

FUJIPOLY DATA SHEET NUMBER FPDS 2K-31 / Version 9

Fuji Polymer Industries Co., Ltd. (Overseas office)

JAPAN

FUJIPOLY Bldg., 5-21-1, Meieki, Nakamura-ku, Nagoya, Aichi, 450-0002 Japan

[Phone] +81-52-589-9251 [Web site] https://www.fujipoly.co.jp/ [E-mail] sales@fujipoly.co.jp ISO9001 / IATF16949(Aichi Plant)

Fuji Polymer Industries Co.,Ltd. Korea Liaison Office

SOUTH KOREA

A-404, 97 Yeouidong-ro, Youngdeungpo, Seoul, 07324, Korea

[Phone] +82-2-785-2801 [Web site] https://fujipoly.co.kr/ [E-mail] info@fujipoly.co.kr

Fujipoly Taiwan Co., Ltd.

TAIWAN

Room B, 7F., No. 59, Tiansiang Rd., Jhongshan District, Taipei City 10452, Taiwan

[Phone] +886-2-2586-5771 [Web site] http://www.fujipoly.com.tw/ [E-mail] fujipolytw@fujipoly.com.tw

Fujipoly America Corporation

USA

900 Milik Street P.O. BOX 119 Carteret, NJ 07008-0119, USA

[Phone] +1-732-969-0100 [Web site] https://www.fujipoly.com/ [E-mail] info@fujipoly.com/ISO9001 / IATF16949

| Fujipoly Customer Engineering Resource Center

USA

94 Bonaventura Drive, San Jose, CA, 95134

[Phone] +1-408-708-5980 [E-mail] fpcerc@fujipoly.com

Fujipoly Europe Ltd.

UK

Avant Business Centre, Unit 8, Third Avenue, Bletchley Milton Keynes, MK1 1DR UK

[Phone] +44-1908-277800 [Web site] https://www.fujipoly.eu/ [E-mail] sales@fujipoly.eu

Fujipoly Europe Ltd. Germany Liaison Office

GERMANY

[Phone] +49-7156-9278310 [Web site] https://www.fujipoly.eu/ [E-mail] support.germany@fujipoly.eu

Fujipoly (Thailand) Co.,Ltd.

THAILAND

55/8 Moo 13 Navanakorn Industrial Estate Phase 4, Phaholyothin Road.Klong Nueng,Klong Luang,Pathumthanee 12120, Thailand [Phone] +66-2-529-2732 [E-mail] marketing@fujipoly.co.th
ISO9001 / ISO14001 / IATF16949

Fujipoly Singapore Pte Ltd.

SINGAPORE

1001 Jalan Bukit Merah #02-17/20 Singapore 159455

[Phone] +65-6272-3766 [Web site] https://www.fujipoly.sg [E-mail] info@fujipoly.com.sg

Fujipoly Hong Kong Ltd.

HONG KONG

Workshop(F&J),Block1,4/F.,Kwai Tak Industrial Centre,15-33 Kwai Tak Street,Kwai Chung,N.T.,Hong Kong. [Phone] +852-2428-3770 [E-mail] info@fujipoly.com.hk

Fujipoly Trading (Shenzhen) Co.,Ltd.

CHINA

Room 2703, Diwang Commercial Building, Shunhing Square, 5002 Shennan East Road, Luohu District, Shenzhen, 518022, China [Phone] +86-755-8237-5494 [Web site] http://www.fujipoly.net.cn [E-mail] info@fujipoly.com.hk

Fujipoly China (Dongguan) Electronics Co.,Ltd.

CHINA

Gaobao Road 10, Tutang Estate, Changping, Dongguan, Guangdong, 523581, China

 $\begin{tabular}{ll} \textbf{[Phone]} + 86-769-8398-9660 & \textbf{[E-mail]} \textbf{info@fujipoly.com.hk} \\ \end{tabular}$

ISO9001 / ISO14001

Pag	ge
1] Product Name 02	2 -
2] Features	2 -
3] Variety of Carbon Zebra Connector. (Table-1 · 2) · · · · · · · · · · · · · · · · ·	3 -
4] Series of Carbon Connector and Low Temperature Carbon Connector.(Table-3) · · · · · · · - 04	4 -
5] Maximum Available Size and Standard Widths. (Table-4)	5 -
6] Tolerance Table.(Table-5, 6, 7)	6 -
7] Typical Product Properties.(Table-8)	7 -
8] Typical Material Properties.(Table-9)	7 -
9] Calculation of Resistance and Force Defiection(Table-10 · 11 · 12) · · · · · · · · · 08	8 -
10] Others	9 -
11] Trade Marks	9 -


1] Product Name:

Carbon ZEBRA Connector.

Low Temperature Carbon ZEBRA Connector

2] Features:

FUJIPOLY Carbon Zebra Connectors and Low Temperature Carbon Zebra Connectors consist of alternating layers of conductive carbon filled and non-conductive silicone rubber. Contact density of the carbon Zebra Connector is greater than the contact pad density of either LCD (Liquid Crystal Display) or PCB (Printed Circuit Board). At least one conductive layer will

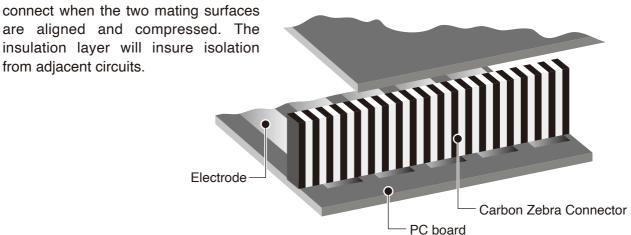

-1)SOLDERLESS CONNECTIONS

Pressure type contact eliminates lead straightening, hole drilling and soldering.

-2)NONABRASIVE CONTACTS (ZERO INSERTION FORCE)

Contact to the LCD is made by deflecting the Carbon Zebra connector between the LCD and PC board. Carbon Zebra connectors are nonabrasive and will not damage indium oxide contact pads on the LCD. Repeated assembly and disassembly of package components will not affect performance.

-3) ENVIRONMENTAL RELIABILITY

The LCD, when mounted with a Carbon Zebra rubber connector, creates a gas tight seal at the contact interface. Assures contact in chemically corrosive atmospheres while at the same time protecting the glass display from shock and vibration.

-4)SMALL GLASS OVERHANG

With a Carbon Zebra connector, LCD terminal overhangs can be as narrow as 0.030"/0.80mm permitting more efficient use of glass size related to character height. (Metal pins normally require a 0.150"/3.8mm glass overhang, reducing character height by as much as 0.240"/6.1mm for a dual in-line LCD.)

-5)HIGH DENSITY CONTACT


Carbon Zebra connectors are available in a variety of contact densities. The most dense allows contact pad spacing as close as 0.010"/0.25mm center-to-center. This spacing can be compared to 0.050"/1.3mm minimum for pins, allowing for increased capacity of LCD formats.


-6)LABOR SAVING EASE OF ASSEMBLY

3] Variety of Carbon Zebra Connector.


Table - 1

Type of	Series	Series LCD Fig		Figure-2	Figure-3	Figure-4
Zebra			Plain - Type	Insulation Barrier - Type	Solid Self- Support - Type	Sponge Self- Support - Type
	1002 (CZ410 / CZ710)	0.010"(0.25mm)	Available	Available	Available	Available
Carbon Connector (Standard)	2004 (CZ418)	0.020"(0.50mm)	Available	Available	Available	Available
	2005 (CZ405 / CZ705)	0.006"(0.15mm)	Available	Available	Available	Available
Low Temperature Cobon Connector	LT200 (CZ610)	0.010"(0.25mm)	Available	Available	Available	Not Available

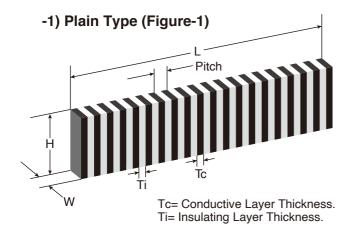


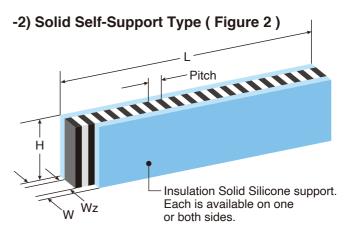

-3) Insulation Barrier Type (Figure-3)

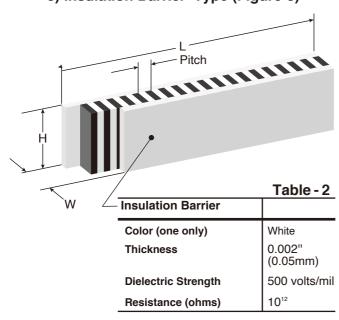

-4) Sponge Self-Support Type (Figure 4)

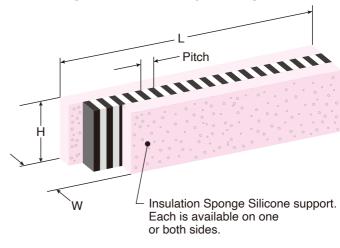


4] Series of Carbon Connector (Standard) and Low Temperature Carbon Connector

Table - 3

	LCD Contact Spacing Center-to-Center	LCD Sum of the Th an Adjacent C and non-Cond	Conductive	Conductive Layer per inch	Individual Cand Insulating La Thickness		Available Lengths
Series	Minimum	Nominal	Maximum	Minimum	Minimum	Maximum	Maximum
1002	0.015"	0.004"	0.006"	240	0.001"	0.004"	9.0"
(CZ410 / CZ710)	(0.38 mm)	(0.10 mm)	(0.15 mm)		(0.025 mm)	(0.10 mm)	(230 mm)
2004	0.020"	0.007"	0.010"	140	0.002"	0.006"	9.0"
(CZ418)	(0.50 mm)	(0.18 mm)	(0.25 mm)		(0.050 mm)	(0.15 mm)	(230 mm)
2005	0.010"	0.002"	0.004"	500	0.0004"	0.0024"	9.0"
(CZ405 / CZ705)	(0.25 mm)	(0.050 mm)	(0.10 mm)		(0.010 mm)	(0.060 mm)	(230 mm)
LT200	0.015"	0.004"	0.006"	240	0.001"	0.004"	5.0"
(CZ610)	(0.38 mm)	(0.10 mm)	(0.15 mm)		(0.025 mm)	(0.10 mm)	(127 mm)

Figure - 5

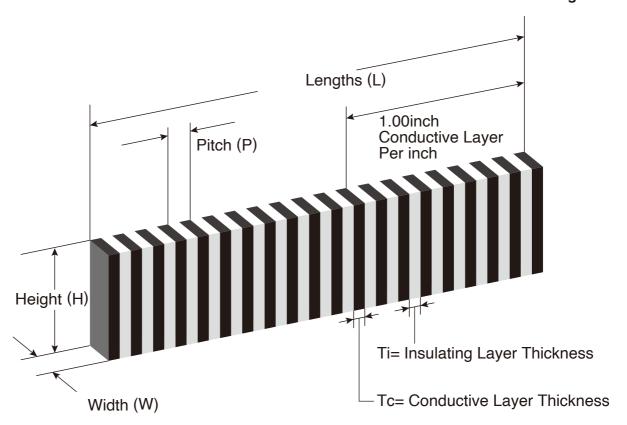

5] Maximum Available Size and Standard Widths.

Table - 4

	Series	Available Lengths	Standard Widths
Plain Type	1002 (CZ410 / CZ710) 2004 (CZ418) 2005 (CZ405 / CZ705)	9.00" (230mm)	0.015"~0.118" (0.38mm~3.00mm) above 0.118" Consult factory
	LT200 (CZ610)	5.00" (127mm)	
Insulation Barrier Type	1002 (CZ410 / CZ710) 2004 (CZ418) 2005 (CZ405 / CZ705)	9.00" (230mm)	0.015"~0.118" (0.38mm~3.00mm) above 0.118" Consult factory
	LT200 (CZ610)	5.00" (127mm)	
Solid Self - Support Type	1002 (CZ410 / CZ710) 2004 (CZ418) 2005 (CZ405 / CZ705)	9.00" (230mm)	0.050" (1.27mm) 0.090" (2.30mm) 0.060" (1.50mm) 0.100" (2.50mm) 0.070" (1.80mm) 0.120" (3.00mm)
	LT200 (CZ610)	5.00" (127mm)	0.080" (2.00mm) 0.140" (3.50mm)
Sponge Self - Support Type	1002 (CZ410 / CZ710) 2004 (CZ418) 2005 (CZ405 / CZ705)	9.00" (230mm)	0.060" (1.50mm) 0.087" (2.00mm) 0.118" (3.00mm) 0.063" (1.60mm) 0.091" (2.30mm) 0.126" (3.20mm) 0.067" (1.70mm) 0.100" (2.50mm) 0.138" (3.50mm) 0.070" (1.80mm) 0.102" (2.60mm) 0.150" (3.80mm) 0.075" (1.90mm) 0.106" (2.70mm) 0.157" (4.00mm) 0.079" (2.00mm) 0.110" (2.80mm)

6] Tolerance Table.

-1) Plain type Connector / Insulation Barrier Connector.

Table - 5

Measurement	Mark	MM : Size and Tolerance	inch : Size and Tolerance
Length	L	4.00 ~ 61.00 ±0.20 61.20 ~ 152.40 ±0.38 152.60 ~ 200.00 ±0.50 200.10 ~ 230.00 ±1.00	0.157" ~ 2.400" ±0.008" 2.410" ~ 6.000" ±0.015" 6.010" ~ 7.870" ±0.020" 7.880" ~ 9.000" ±0.039"
Height	н	0.50 ~ 19.00 ±0.127 above 19.00 Consult factory	0.020" ~ 0.750" ± 0.005" above 0.750" Consult factory
Width	w	$0.38 \sim 1.00 \pm 0.050$ $1.01 \sim 2.00 \pm 0.076$ $2.01 \sim 3.00 \pm 0.127$ above 3.00 Consult factory	0.015" ~ 0.039" ±0.002" 0.040" ~ 0.079" ±0.003" 0.080" ~ 0.118" ±0.005" above 0.118" Consult factory

-2) Solid Self-Support Connector.

Table - 6

Measurement	Mark	MM : Size and Tolerance	inch : Size and Tolerance
Length	L	4.00 ~ 61.00 ±0.20 61.20 ~ 152.40 ±0.38 152.60 ~ 200.00 ±0.50 200.10 ~ 230.00 ±1.00	0.157" ~ 2.400" ±0.008" 2.410" ~ 6.000" ±0.015" 6.010" ~ 7.870" ±0.020" 7.880" ~ 9.000" ±0.039"
Height	н	1.00 ~ 19.00 ±0.127 above 19.00 Consult factory	0.039" ~ 0.750" ±0.005" above 0.750" Consult factory
Width	w	$1.27 \sim 2.00 \pm 0.15$ $2.03 \sim 2.54 \pm 0.18$ $2.55 \sim 3.50 \pm 0.20$ above 3.50 Consult factory	0.050" ~ 0.079" ±0.006" 0.080" ~ 0.100" ±0.007" 0.101" ~ 0.140" ±0.008" above 0.140" Consult factory

-3) Sponge Self-Sopport Connector.

Table - 7

Measurement	Mark	MM : Size and Tolerance	inch : Size and Tolerance
Length	L	$4.00 \sim 61.00 \pm 0.20$ $61.20 \sim 152.40 \pm 0.38$ $152.60 \sim 200.00 \pm 0.50$	0.157" ~ 2.400" ±0.008" 2.410" ~ 6.000" ±0.015" 6.010" ~ 7.870" ±0.020"
Height	н	1.00 ~ 19.00 ±0.127 above 19.00 Consult factory	0.039" ~ 0.750" ±0.005" above 0.750" Consult factory
Width	W	1.52 ~ 4.00 ±0.10 above 4.00 Consult factory	0.060" ~ 0.157" ±0.004" above 0.157" Consult factory

7] Typical Product Properties.

Table - 8

Operating Temperature Range	(Standard) Carbon Connector Series: 1002 (CZ410 / CZ710) / 2004 (CZ418) / 2005 (CZ405 / CZ705)	-55°F ~ +260°F (-50°C ~ +125°C)	
operating reinperature nange	Low Temperature Carbon Connector Series: LT200 (CZ610)	-85°F ~ +2 (-65°C ~ +	
Current Carrying Capacity	(Standard) Carbon Connector Series: 1002 (CZ410 / CZ710) / 2004 (CZ418) / 2005 (CZ405 / CZ705)	50mA	0.035" x 0.035" Pad
	Low Temperature Carbon Connector Series: LT200 (CZ610)	50mA	(0.90mm x 0.90mm)
Resistance Between Layers	(Standard) Carbon Connector Series: 1002 (CZ410 / CZ710) / 2004 (CZ418) / 2005 (CZ405 / CZ705)	10 ¹² ohms	
nesistance between Layers	Low Temperature Carbon Connector Series: LT200 (CZ610)	10 ¹² ohms	

8] Typical Material Properties.

Table - 9

Item	Conductive Layer	Insulating Layer	Support Rubber	Support Sponge
material	Carbon Filled Silicone Rubber	Non-conductive Silicone Rubber	Non-conductive Silicone Rubber	Non-conductive Silicone Sponge
Color	Black	Off-white	Light blue	Pink
Hardness Shore A	73	70	25	10
Tensile Strength MPa	5.8	6.9	4.9	2.9
Elongation %	100	250	250	100
Tear Strength KN/m	7	10	10	5
Volume Resistivity MΩ·m	5x10 ⁻⁸	1x10 ⁶	1x10 ⁶	1x10 ⁶

9] Calculation of Resistance and Force Deflection.

-1) Resistance.

For the purpose of calculating the resistance of a Carbon Connector and testing them for compliance, please use the following formula.

Table - 10

Inches	Metric
$R = \frac{2.37 \times h}{(EW \times W)} = ohms$	$R = \frac{60 \times h}{(EW \times W)}$ Where, cw, and w arein "cm"
Ew = Electrode Pad width in inches W = Width of ZEBRA portion in inches H = Connector Height (H) in inches	Ew = Electrode Pad width in mm w = Width of ZEBRA portion in mm h = Connector Height (H) in mm

-2) Force Deflection.

Connector should be deflected 5% to 25% of Height (H) To calculate Force for deflection, use following formula.

Plain ZEBRA or Insulation Barrier Type

Table - 11

Inches	Metric			
$F(N) = 5806D \times W \times L \times 9.8 \times 10^{-3}$	$F(N) = 9D \times W \times L \times 9.8 \times 10^{-3}$			
$D = \frac{H - H_1}{H} \times 100\% $ (Deflection in percent)				
H = Height of Connector (inches or mm)				
H ₁ = Deflected height of Connector (inches or mm)				
L = Length of Connector (inches or mm)				
W = Width of Connector (inches or mm)				

Insulation Silicone Support Type

Table - 12

,	145.6 12		
Inches	Metric		
$F (N) = [(5806D \times W \times L) + \{1161D \times (W - W_1) \times L\}] \times 9.8 \times 10^{-3}$	$F (N) = [(9D \times W \times L) + \{1.8D \times (W - W_1) \times L\}] \times 9.8 \times 10^{-3}$		
$D = \frac{H - H_1}{H} \times 100\% $ (Deflection in percent)	1		
H = Height of Connector (inches or mm)			
H ₁ = Deflected height of Connector (inches or mm)			
L = Length of Connector (inches or mm)			
W = Width of Connector (inches or mm)			
W ₁ = Width of ZEBRA Connector (inches or mm)			

10] Others

FUJIPOLY website http://www.fujipoly.com/

11] Trade Marks



ZEBRA

Notes:

- All FUJIPOLY test data in this document is based on FUJIPOLY test method and is believe to be
 accurate and reliable. Nevertheless, any FUJIPOLY test data shows typical product properties, and does
 not show the guaranteed product properties.
- Some Silicone oil could exude from the product according to operating conditions.
- Some low molecular Siloxane could vaporize from the product according to operating conditions.
- It is advisable to use the product under recommended operating condition. Some more Silicone oil could exude from the product if it was used over the recommended condition.
- It is advisable to use the product under parallel and even compression. Some more Silicone oil could exude from the product if it was used under excessive or partial stress.
- Products testing by the purchaser is recommended in order to meet expected results such as performance and application.

: March.24th 2023 version 9 : April.18th 2008 version 8 : January.16th 2006 version 7 : September.1st 2005 version 6 : February.14th 2003 version 5 : January.31th 2002 version 4 : January.8th 2001 version 3 : December.8th 2000 version 2

ISSUED : July.31th 2000 version 1

STATEMENT OF LIEU OF WARRANTY: All technical information and data in this document is based on tests and is believed to be accurate and reliable. Nevertheless, since the products described herein are not provided to conform with mutually accepted specifications and the use thereof is unknown, the manufacturer and seller of the product do not guarantee results, freedom from patent infringement, or suitability of the product for any application thereof. The manufacturer and seller of the product, described in this document will provide all possible technical assistance and will replace any products proven defective. No statement or recommendation made by the manufacturer or seller, not contained herein, shall have any force of effect unless in conformity with an agreement signed by an officer of the seller or manufacturer. Product testing by the purchaser is recommended in order to confirm expected results.

Copyright 2023 FUJIPOLY.

FUJIPOLY is registered Trademarks of FUJIPOLY Group.